SONY

Technical Bulletin

Date	Ref. No.	Model	FB
12.01.99	**TV10598R**	**KV-28FX60B, KV-28FX60D, KV-28FX60E, KV-28FX60U, KV-32FX60B, KV-32FX60D, KV-32FX60D4, KV-32FX60E, KV-32FX60K, KV-32FX60U**	
Subject **No Chroma on AV3 Input [REVISION]**			IRIS F411

SYMPTOM

No chroma on the AV3 input.

CAUSE

JR1045 on the A Board is missing.

SOLUTION

Mount JR1045 on the A Board.

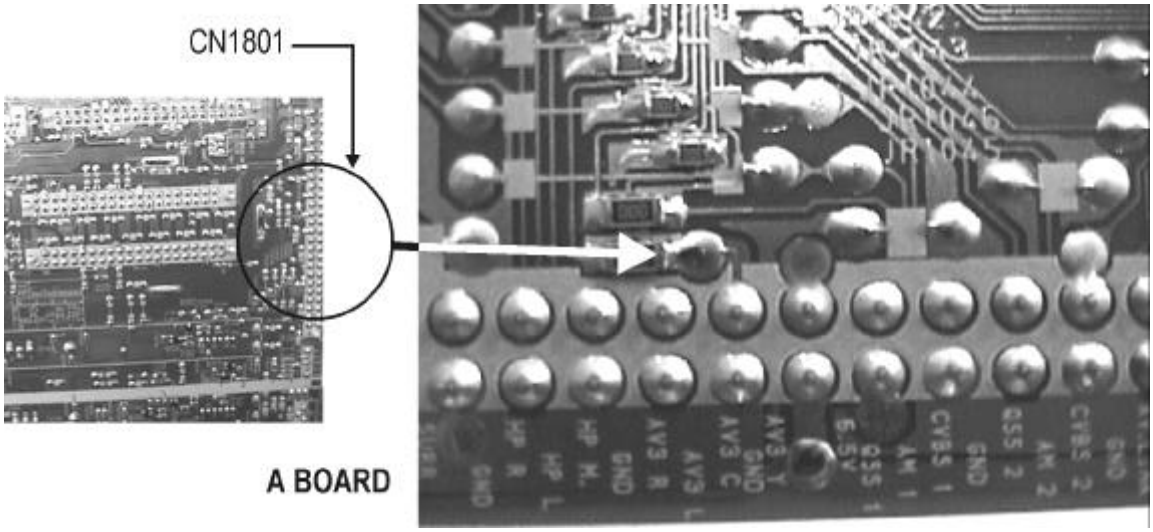

APPLICABLE SERIAL NUMBERS

KV-28FX60B	Up to 5880
KV-28FX60D	Up to 1023
KV-28FX60E	Up to 785
KV-28FX60U	Up to 4152
KV-32FX60B	Up to 3213
KV-32FX60D	Up to 185
KV-32FX60D4	Up to 1001
KV-32FX60E	Up to 1327
KV-32FX60K	Up to 75
KV-32FX60U	Up to 3803

Sony Customer Relations & Service Europe
European Technical Support
Technologielaan 7
B - 1840 Londerzeel